# Inspection 17/02/2023 Copy 4 Bedroom, Example Developers


22 Example Close

Created: 28 Mar 2023 Last Updated: 28 Mar 2023 Prepared for: Mr And Mrs Example




21465%172TESTS COMPLETEDOVERALL SCOREACTIONS REQUIREDRESPONSIBLE PERSONACTIONS ASSIGNED<br/>0(0%)0(%)

	0 (0%)
Builder	77 (45%)
Carpenter	20 (12%)
Electrician	4 (2%)
Plumber	9 (5%)
Tiler	3 (2%)
Kitchen Insaller	0 (0%)
Landscaper	1 (1%)
Decorator	55 (32%)
Unassigned	0 (0%)
Unassigned	3 (2%)

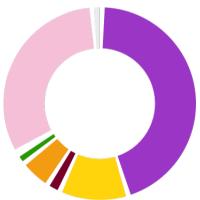

# New Build Inspections

	RESULT	COMMENTS
ABOUT		
1.1 The Property	N/A	The property inspected at the time of inspection was a four bedroom detached David Wilson house.
1.2 Meet Your Inspector	Pass	Your inspector today , is an experienced professional . He has been assessed as competant though the New Homes Quality Board scheme You inspector carries relevent insurances and will be a member
		of one of the following professional bodies CIOB, RICS, RPSA, SAVA, ABBE or other recognised body
1.3 Our Service & Limitations to the Inspection	Pass	The inspection of your property will undertaken by a suitably qualified inspector and should be non-disruptive and non- invasive and should assess fixtures, fittings and services by way of checks comparable with normal daily use. It has been approved by an industry-wide technical working group in collaboration with the New Homes Quality Board
		(NHQB) and its availability is a requirement of the New Homes Quality Code.
		The purpose of this Checklist is to assist the home building industry show a commitment to cooperation and transparency in delivering a high-quality standard to every new home.
		The homebuyer can and should expect their home to be constructed to a high specification and that the approach to the home and surrounding area is safe on the day they move in. The home should be clean and ready for the customer to enjoy and live in safely from day one.
		Inspectors will follow the NHQB guidance below when completing the inspection and where it isn't possible to comply with the guidance make reference to this limitation in the inspection notes:
		Please note the following methodology must be used by the inspector
		<ul> <li>External walls should be inspected in daylight from a minimum distance of 10m.</li> </ul>
		<ul> <li>Internal ceiling, wall, paintwork finishes, mastic and sealing should be inspected in daylight from a minimum distance of 2m and not shining a light on the surface.</li> <li>Where no natural daylight is available, inspection should be carried out with a single light source.</li> </ul>
		<ul> <li>Cupboards, wardrobes, surfaces and fitted furniture (including kitchens and bathrooms) should be inspected in daylight from a distance of 0.5m.</li> </ul>
		• Glazing should be inspected in daylight from a minimum distance of 2m (laminated or toughened glass from 3m) and not shining a light on the surface, with fine scratches less than 25mm and bubbles or blistersif they are neither obtrusive or bunched, being acceptable.
		<ul> <li>All checks on the property unless otherwise stated will be visual from the ground [in the case of exterior] or from internal floors [in the case of the interior].</li> </ul>
		<ul> <li>For top floor apartments, loft spaces and eaves should only be checked where safely accessible to do so.</li> </ul>
	•	'

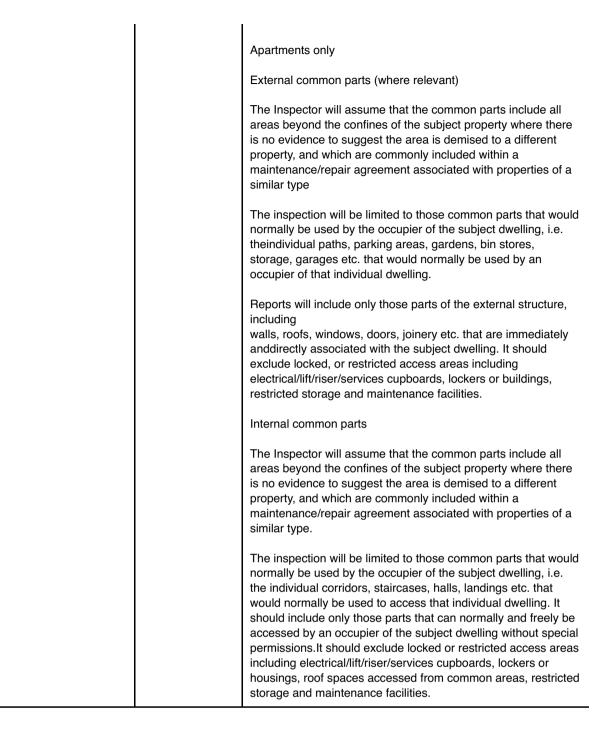



GENERAL					
3.1 Health & Safe	ty	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	At the time of inspection the right- hand side elevation has yet to be fully complete and finished

3.2 Scaffoldi	ng	Pass	hand side e		nere was arris fencing to the right g access difficult but protecting the retaining wall
3.3 Roads &	Footpaths	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Damage is noted to the front of the steps leading up to the front entrance door
	Action 2	Builder	N/A	No	Please clean down the steps leading up to the front entrance door
	Action 3	Builder	N/A	No	The curb edging at the time of inspection to the front elevation was damaged in numerous areas and sections were missing
3.4 Tidiness		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	The driveway at the time of inspection was dirty and requires cleaning down prior to completion
	Action 2	Builder	N/A	No	Please clean down the retaining wall and the drainage to the retaining wall
	Action 3	Builder	N/A	No	The front elevation at the time of inspection had not yet been completed
	Action 4	Builder	N/A	No	Please clean down the soffit and fascia board to the garage
	Action 5	Builder	N/A	No	Vegetation growing to the rear elevation requires removing prior to the turf being laid
	Action 6	Builder	N/A	No	Rear elevation in numerous areas requires cleaning down prior to handover
	Action 7	Builder	N/A	No	Please remove all rubble and debris from the rear garden prior to the turf being laid
	Action 8	Builder	N/A	No	The brickwork to the right-hand side of the garage requires jet washing down
	Action 9	Builder	N/A	No	Roof to the garage requires cleaning down prior to completion
	Action 10	Builder	N/A	No	The rear elevation generally requires to be clean down prior to completion
	Action 11	Carpenter	N/A	No	Threshold bar to the utility room door would benefit from being refinished
	Action 12	Builder	N/A	No	Please clean down the glazing to the utility room door
	Action 13	Builder	N/A	No	Please remove the plot board and make good the holes in the pointing to the brickwork once the plot board has been removed
	Action 14	Builder	N/A	No	Please remove nails and screws from the vented soffit board





























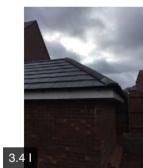

 







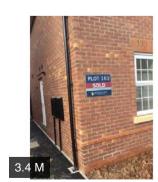






	Action 1	Builder	N/A	No	Please remove debris from around the drain pipe to the left-hand side elevation
	Action 2	Builder	N/A	No	Numerous damaged brickwork to the retaining wall builder please make good
	Action 3	Builder	N/A	No	Please clean down the brickwork to the retaining wall
	Action 4	Builder	N/A	No	Poor workmanship from the bricklayer to the right-hand side of the garage door large gap is noted between the garage door and the brickwork and at the time of inspection there has been no mastic seal be made around the perimeter of the garage door itself
	Action 5	Builder	N/A	No	Damaged brickwork noted to the right-hand side of the garage door
	Action 6	Builder	N/A	No	Inconsistent colour match is noted to the mortar to the brickwork to the right-hand side of the garage
4.2 Render		N/A			
4.3 Cladding		N/A			
4.4 Tile Hangi	ng	N/A			
4.5 Expansior	Jionts	Pass			
4.6 Weeps		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	No drainage or weeps have been fitted to the retaining wall to the rear and to the left-hand side of the rear garden
	Action 2	Builder	N/A	No	It appears as though there was a weep vent fitted to the right-hand side of the kitchen window but has been removed builder please comment
	Action 3	Builder	N/A	No	Damage is noted to the floor vent to the left-hand side elevation
4.7 Air Bricks		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Stonework missing between the patio slabs and the property to the rear elevation
4.8 DPC		Pass			

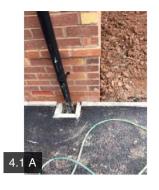






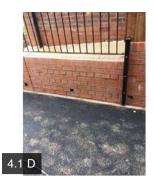



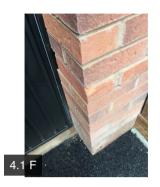












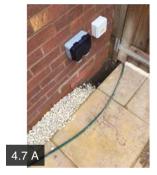

CHIMNEY					
5.1 Bricks & Mor	tar	N/A			
5.2 Render		N/A			
5.3 Post / Termir	nals	N/A			
5.4 Flashings		N/A			
ROOF					
6.1 Tiles / Ridge	S	Pass			
6.2 Flat		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Damage noted to the front left and front right-hand corners of the flat roof section above the French doors leading to the kitchen/dining area
6.3 Leadwork		Pass			





# JOINERY

7.1 Joinery	Pass	
GUTTERS		
8.1 Gutters	Pass	
8.2 Downpipes	Pass	
8.3 Butts	N/A	
BALCONIES		
9.1 Balconies	N/A	
PORCHES		

#### PORCHES


10.1 Porches		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	NHBC requires a mastic seal to be made at the juxtaposition of the upstand and the brickwork in the absence of any lead work. Furthermore I would recommend a seal be made to the portico and legs



CONSERVATORIES / ORANGERY / GARDEN ROOM					
11.1 Conservatori	es / Orangery / Garden Room	N/A			
GARAGES					
12.1 Walls		Pass			
12.2 Floors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments


	Action 1	Builder	N/A	No	At the time of inspection the garage was being used as a storage unit for building materials
12.3 Roofs		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Insulation visible above the garage door, requires a trim installing
12.4 Doors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Transit strips require removing from the bottom of the garage door
	Action 2	Builder	N/A	No	Sealant work missing from the garage door frame
12.5 Windows		N/A			
12.6 Services		N/A			



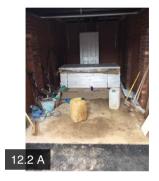






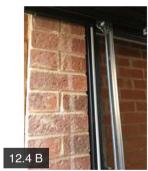



### SURFACES

13.1 Paths & Driv	reways	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Externally the property itself requires jet washing down or acid washing to the property prior to handover
	Action 2	Builder	N/A	No	Please remove all debris and excess tarmac from around the guttering downpipes
13.2 Edgings & K	erbs	Fail		-	
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Curb Edgins at the time of inspection have been damaged or are completely missing

13.3 Lawns		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Landscaper	N/A	No	Landscaping has yet to have been fully completed to this property at the time of inspection
13.4 Steps		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
		U U	Buo Buio	complete.	Action Comments

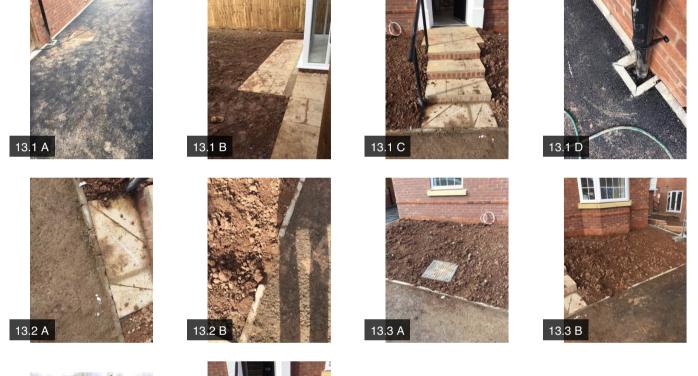

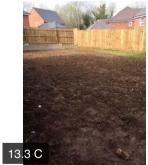


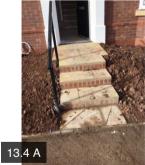

## DRAINS

14.1 Drains		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Not tested / unable to test at the time of inspection
	Action 2	Builder	N/A	No	Homeowner Advisory, monitor the drainage to the driveway especially in the flat area in front of the driveway

Action 3	Builder	N/A	No	Could the builder please clean down the inside of the drain on the driveway
----------	---------	-----	----	---

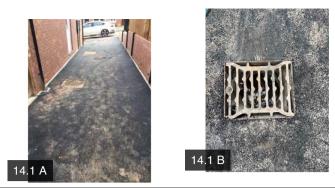


#### VENTS

15.1 Extractors	Pass	
15.2 Flues	Pass	



#### WINDOWS 16.1 Windows Pass DOORS 17.1 Doors Fail Action Assignee Due Date Complete? Action Comments N/A The left hand door handle has Action 1 Builder No been loosely fitted To the French doors Action 2 Carpenter N/A No Threshold bar to the front entrance door would benefit from being

refinished

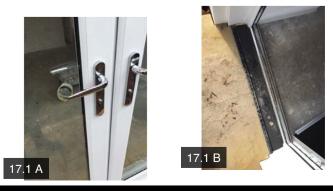

SERVICES

18.1 Taps		Pa	Pass			
18.2 Lights	18.2 Lights		Pass			
18.3 Meter Boxes	18.3 Meter Boxes		ail			
	Action	A	ssignee	Due Date	Complete?	Action Comments
	Action 1	D	)ecorator	N/A	No	Both service boxes externally would benefit from being refinished prior to completion
18.4 Pipes		Pa	ass			
18.5 Sheds		N	J/A			
18.6 Greenhouse	18.6 Greenhouses		I/A			
18.7 Bin Stores		N	I/A			
18.8 Bike Stores		N	I/A			



### BOUNDARIES


19.1 Fences	19.1 Fences				
19.2 Walls		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	As previously mentioned the retaining walls to the rear elevation do not appear to have any form of the weeps fitted can the builder please comment
	Action 2	Builder	N/A	No	Damage noted to numerous areas of the brickwork to the retaining wall to the left-hand side of the driveway
	Action 3	Builder	N/A	No	Builder has used a clear seal to the retaining wall to the left hand side of the driveway, there is no defect with the sealant work however we would have expected the builder to have chosen a different colour in order for it to look as though it has been sealed whereas with a clear seal it looks as though there is just a gap in the retaining wall this is more a Specification issue than a defect
19.3 Gates		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	The slammer strip requires adjusting please











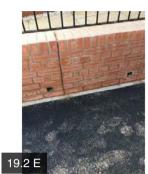

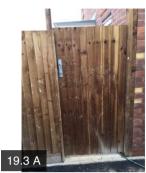


OTHER					
20.1 Air Source Heat Pumps		N/A			
20.2 PV Pan	els	N/A			
HALLWAY					
22.1 Plasteri	ng & Dry Lining	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Tooling marks are noted in the ceiling area directly above the front entrance door frame
22.2 Finishes		Fail		-	
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Poor decorative finish around the triple light switch and also on the single light switch in the hallway area
	Action 2	Decorator	N/A	No	The sealant work has yet to have been fully undertaken to the rear of the three hinges to the rear of the front entrance door
	Action 3	Decorator	N/A	No	General poor decorative finish has been applied around the switches throughout the hallway
22.3 Floors	-	Pass		-	
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Can the builder please clean down all of the snot from the flooring in the hallway
22.4 Window	/S	N/A			
22.5 Skirting	/ Plinths	Pass			
22.6 Doors		Pass			

22.7 Cupboard	ds	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Please clean down the skirting board
	Action 2	Decorator	N/A	No	Poor decorative finish applied around the bank of sockets in the storage cupboard
	Action 3	Decorator	N/A	No	Excess paint is noted in the rear of the storage cupboard door of the hallway
22.8 Glazing		Pass			
22.9 Tiles		N/A			
22.10 Lights		Pass			
22.11 Sockets	i	Pass			
22.12 Consum Location)	2.12 Consumer Unit (Assumed - Indicate ocation)		Location, in	Location, inside storage cupboard	
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Can the builder please clean down the front face of the CCU
22.13 Radiato	rs	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Plumber	N/A	No	Cover caps to the radiators have been poorly fitted and have also been poorly decorated around the radiator tails
	Action 2	Decorator	N/A	No	Further decorative finish is awaiting to be undertaken to be rear of the radiator tails
22.14 Entryph	one	N/A			
22.15 Alarm		N/A			
22.16 Doorbel	I	Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Unable to test at the time of inspection

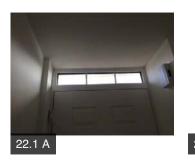






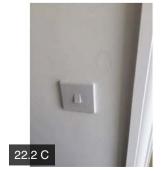








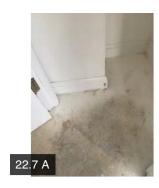


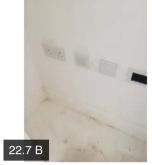







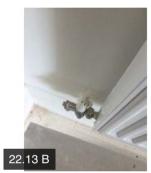



### DOWNSTAIRS WC

23.1 Plastering & Dry Lining		Pass			
23.2 Finishes	23.2 Finishes				
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Poor decorative finishing around the spotlight
	Action 2	Builder	N/A	No	Sealant work required at the junction of wall tiling and door architrave and tiling
23.3 Floors	23.3 Floors				
23.4 Windows	23.4 Windows				
23.5 Skirting / Pl	linths	Pass			
23.6 Doors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Poor finish to the inside of the downstairs WC door frame
	Action 2	Carpenter	N/A	No	Chip noted to the rear face of the downstairs WC door
23.7 Lights		Pass			
23.8 Sockets		N/A			

23.9 Radiators	Pass	
23.10 Shower Tray (if applicable)	N/A	
23.11 Cubicles / Wet Rooms	N/A	
23.12 Basins	Pass	
23.13 Taps & Controls	Pass	
23.14 Pedestals	Pass	
23.15 Toilets & Seats	Pass	
23.16 Shaving Points	N/A	
23.17 Towel Rail	N/A	
23.18 Extractors	Pass	




### STUDY

24.1 Plastering &	Drylining	Pass			
24.2 Finishes		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Poor decorative finish around the light switch and double outlet sockets inside the downstairs study
	Action 2	Decorator	N/A	No	Poor decorative finish around the double outlet sockets
	Action 3	Decorator	N/A	No	Poor finish to the window board inside of the downstairs study in numerous areas
	Action 4	Decorator	N/A	No	Debris is noted to the window board inside of the downstairs study
	Action 5	Decorator	N/A	No	Touching up required in the wall area to the rear of the downstairs study room door
24.3 Floors		Pass			
24.4 Windows		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Requires cleaning down Prior to handover please
24.5 Skirting / Pli	nths	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments


	Action 1	Builder	N/A	No	Please clean down the skirting board around the perimeter of the room	
24.6 Doors		Pass				
24.7 Lights		Pass				
24.8 Sockets	24.8 Sockets					
24.9 Radiators		Fail				
	Action	Assignee	Due Date	Complete?	Action Comments	
	Action 1	Plumber	N/A	No	Poor fitting of the cover caps to the radiator tails	
	Action 2	Decorator	N/A	No	Further decorative attention is required to the rear of the radiator tails	





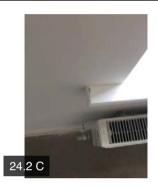




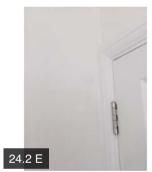








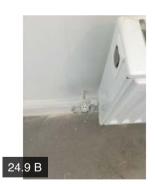


LIVING ROOM 1							
25.1 Room Name		Pass	Lounge				
25.2 Plastering & Dry Lining		Pass					
25.3 Finishes	25.3 Finishes						
	Action	Assignee	Due Date	Complete?	Action Comments		
	Action 1	Decorator	N/A	No	Pencil marks noted in the wall area above the double socket requires further decorative attention		


	Action 2	Decorator	N/A	No	Debris is noted to the window board finish builder please make good
	Action 3	Decorator	N/A	No	Pencil marks are noted to the left- hand window reveal awaiting further decorative attention
	Action 4	Decorator	N/A	No	Patches noted in the wall area to the right-hand side of the light switch
	Action 5	Decorator	N/A	No	The window boards inside the lounge area would benefit from being redecorated prior to completion
	Action 6	Decorator	N/A	No	Further decorative attention is required around the media point inside the lounge area
25.4 Floors		Pass			
25.5 Windows		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Requires cleaning down Prior to handover
25.6 Skirting / Pli	nths	Pass			
25.7 Doors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Carpenter	N/A	No	Please make good the front face of the living room door
	Action 2	Carpenter	N/A	No	Damage noted to the inside of the lounge door frame
	Action 3	Carpenter	N/A	No	Damage is noted around the latch plate keep at the time of inspection
25.8 Lights		Pass			
25.9 Sockets		Pass			
25.10 Radiators		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Plumber	N/A	No	Cover cap missing to the radiator tail at the time of inspection

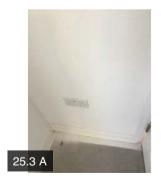





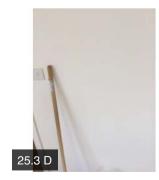

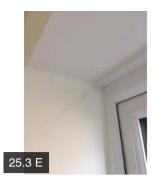








25.7 A



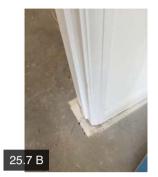

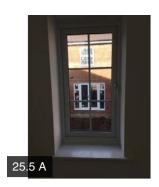

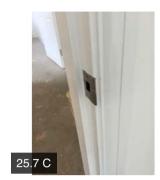




LIVING ROOM 2	
26.1 Room Name	
26.2 Plastering & Dry Lining	
26.3 Finishes	
26.4 Floors	
26.5 Windows	
26.6 Skirting / Plinths	
26.7 Doors	
26.8 Lights	
26.9 Sockets	
26.10 Radiators	
LIVING ROOM 3	
27.1 Room Name	
27.2 Plastering & Dry Lining	
27.3 Finishes	
27.4 Floors	

27.5 Windows					
27.6 Skirting / P	linths				
27.7 Doors					
27.8 Lights					
27.9 Sockets					
27.10 Radiators					
DINING AREA /	DINING ROOM				
28.1 Plastering	& Dry Lining				
28.2 Finishes					
28.3 Floors					
28.4 Windows					
28.5 Skirting / P	linths				
28.6 Doors					
28.7 Lights					
28.8 Sockets					
28.9 Radiators					
KITCHEN					
29.1 Plastering	& Dry Lining	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Scarring and tooling marks are noted in the ceiling area can the builder please make good
	Action 2	Builder	N/A	No	Scarring and tooling marks noted in the ceiling area above the wall mounted cupboard units
29.2 Finishes	-	Fail		•	
	Action	Assignee	Due Date	Complete?	Action Comments

Action	Assignee	Due Date	Complete?	Action Comments
Action 1	Decorator	N/A	No	Poor decorative finish to the window reveals and also to the edges of the window reveals throughout the kitchen area
Action 2	Decorator	N/A	No	Poor finish and fitting noted around numerous spotlights to the ceiling inside the kitchen area
Action 3	Builder	N/A	No	Poor finish to the end of the up stand in the kitchen area requires cleaning down
Action 4	Decorator	N/A	No	Further decorative attention is required around the bank of sockets to the right-hand side of the splashback to the rear of the hob


	Action 5	Decorator	N/A	No	Touching up required in the wall area to the left-hand side of the utility room door Sealant work missing between the end panel and the wall to the left-
					hand side of the utility room door
	Action 6	Decorator	N/A	No	Numerous pencil marks are noted in the wall area in the under stairs cupboard
29.3 Floors		Pass			
29.4 Windows		Pass			
29.5 Skirting / Pl	inths	Fail			
29.6 Doors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Unassigned	N/A	No	
	Action 2	Unassigned	N/A	No	
29.7 Lights		Fail			
29.8 Sockets		Pass			
29.9 Radiators		Fail			
29.10 Cupboards	6	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Unassigned	N/A	No	
29.11 Drawers		Pass			
29.12 Kitchen Fit	ttings	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Scratch noted to the AEG hob
29.13 Tiles		Pass			
29.14 Taps & Co	ntrols	Pass			
29.15 Extractors		Pass			
29.16 Hob / Coo	ker	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Scratch noted to the hob
29.17 Fridge / Fr	eezer	Pass			
29.18 Dishwashe	er	Pass			
29.19 Washing N	lachine	Pass			
29.19 Washing N	lachine	Pass			

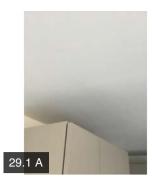

29.2 C

29.2 G


29.5 A

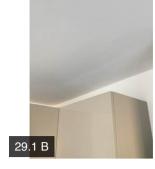



29.2 D


29.2 H



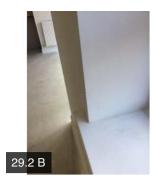

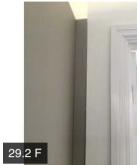

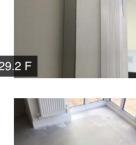

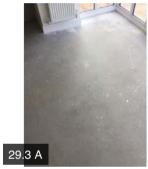











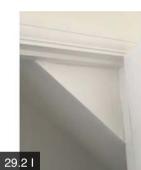




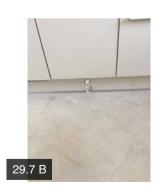









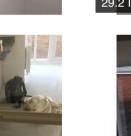


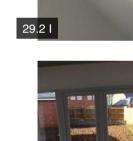





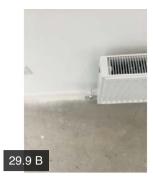

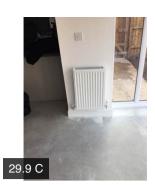















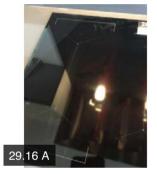


### UTILITY ROOM / CUPBOARD

30.1 Plastering & Dry Lining		Pass			
30.2 Finishes		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Patches are noted in the wall area to the rear of the utility room door
	Action 2	Decorator	N/A	No	Further decorative attention is required in the wall area to the right-hand side of the utility room light switch
	Action 3	Decorator	N/A	No	Poor decorative finish is noted around the double light switch inside the utility room
	Action 4	Decorator	N/A	No	Poor finish in the reveals around the utility room door and poor finish is noted to the rear of the hinges to the utility room door
	Action 5	Decorator	N/A	No	Pencil marks are noted around the isolator switch for the extractor fan requires touching up
30.3 Floors		Pass			
30.4 Windows		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments

	Action 1	Builder	N/A	No	Please remove the sticky pads from the glazing to the utility room door
30.5 Skirting / Pli	inths	Pass			
30.6 Doors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Please clean down the latch edge of the utility room door
30.7 Lights		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Poor fitting and finish around the spotlight inside the utility room
30.8 Sockets		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Further decorative attention is required around the double socket and switched spurs
30.9 Radiators		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Poor fitting of the cover cap and poor finish in the wall area adjacent to the radiator tail
30.10 Cupboards	6	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	The wall mounted cupboard units inside the utility room do not align with each other and require some minor adjustment
30.11 Drawers		N/A			
30.12 Kitchen Fit	ttings	N/A			
30.13 Tiles		N/A			
30.14 Taps & Co	ntrols	N/A			
30.15 Extractors		Pass			
30.16 Fridge / Fr	eezer	N/A			
30.17 Dishwashe	er	N/A			
30.18 Washing M	lachine	Pass			

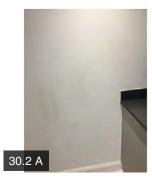

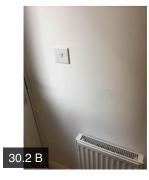











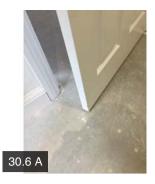

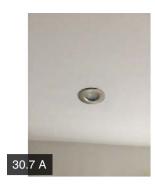









### STAIRS & LANDING 1


31.1 Plastering & Dry Lining		Pass			
31.2 Finishes		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Pencil marks noted in the wall area above the single light switch at the bottom of the stairs
	Action 2	Decorator	N/A	No	Touching up required in the wall area in numerous areas leading up the stairs
	Action 3	Decorator	N/A	No	Debris is noted to the newel cap To the newel post at the top of the stairs
	Action 4	Decorator	N/A	No	Poor finish around the light switches on the landing area
	Action 5	Decorator	N/A	No	Pencil marks are noted in the wall area to the right hand side of the bedroom doors
31.3 Floors		Pass			
31.4 Windows		N/A			
31.5 Skirting / Pli	nths	Pass			
31.6 Doors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Carpenter	N/A	No	Cylinder cupboard door does not latch
31.7 Cupboards		Pass			
31.8 Glazing		N/A			
31.9 Tiles		N/A			
31.10 Lights		Pass			


31.11 Sockets		Pass			
31.12 Radiators		Pass			
31.13 Smoke / Heat / CO2 Detectors		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
_	Action 1	Builder	N/A	No	Please remove the dust cover cap from the smoke detector on the landing area

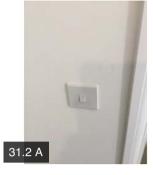

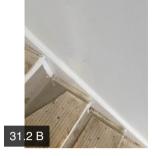



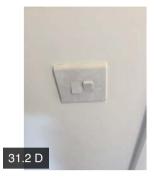

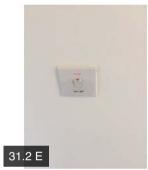









STAIRS & LANDING 2	
32.1 Plastering & Dry Lining	
32.2 Finishes	
32.3 Floors	
32.4 Windows	
32.5 Skirting / Plinths	
32.6 Doors	
32.7 Cupboards	
32.8 Glazing	
32.9 Tiles	
32.10 Lights	
32.11 Sockets	
32.12 Radiators	
32.13 Smoke / Heat / CO2 Detectors	
STAIRS & LANDING 3	
33.1 Plastering & Dry Lining	

33.2 Finishes		l			
33.3 Floors					
33.4 Windows					
33.5 Skirting / Plinths					
33.6 Doors					
33.7 Cupboards					
33.8 Glazing					
33.9 Tiles					
33.10 Lights					
33.11 Sockets					
33.12 Radiators					
33.13 Smoke / Heat / Co	O2 Detectors				
MASTER BEDROOM					
34.1 Room Name		Pass	Mater bedro	om	
34.2 Plastering & Dry Li	ning	Pass			
34.3 Finishes	34.3 Finishes				
Actic	on	Assignee	Due Date	Complete?	Action Comments
Actic	on 1	Decorator	N/A	No	Poor fitting and finish around the spotlight in the bedroom area
Actic	on 2	Decorator	N/A	No	Further decorative attention is required to the window reveals
34.4 Floors		Pass			
34.5 Windows		Fail			
Actic	on	Assignee	Due Date	Complete?	Action Comments
Actic	on 1	Builder	N/A	No	Gaps are noted between the beading sections to the window
34.6 Skirting / Plinths		Pass			
34.7 Doors		Pass			
34.8 Lights		Pass			
34.9 Sockets		Pass			
34.10 Radiators		Pass			
34.11 Wardrobes		Fail			
Actic	on	Assignee	Due Date	Complete?	Action Comments
Actic	on 1	Carpenter	N/A	No	Please remove the plastic protective film from the built in wardrobe
Actic	on 2	Builder	N/A	No	Over paint is noted to the top of the built-in wardrobe and requires cleaning down
34.12 Drawers		N/A			




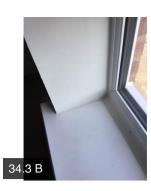

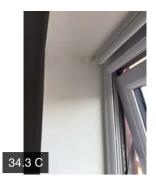





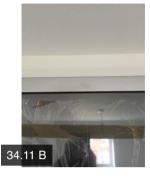

#### MASTER BEDROOM ENSUITE

35.1 Plastering & Dry Lining		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Scarring and tooling marks are noted in the ceiling area adjacent the spotlight above the shower
35.2 Finishes	35.2 Finishes				
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Port decorative finish has been applied around the double light switch
	Action 2	Decorator	N/A	No	Poor finish and fitting around numerous spotlights inside the ensuite bathroom
35.3 Floors		Pass			
35.4 Windows	35.4 Windows				
35.5 Skirting / F	Plinths	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Carpenter	N/A	No	Damage noted to the skirting board to the right hand side of the shower
	Action 2	Carpenter	N/A	No	Gaps opening up between the corner joints of the skirting board can the builder please make good
35.6 Doors		Pass		-	
35.7 Lights		Pass			
35.8 Sockets		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Not tested at the time of inspection
35.9 Radiators		Pass			

	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Builder please clean down the wall tiling adjacent the towel warmer tiles
35.10 Baths		N/A			
35.11 Shower Tra	ys	Pass			
35.12 Cubicles / V	Vet Rooms	Pass			
35.13 Basins		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Plumber	N/A	No	At the time of inspection the handbasin and the basin pedestal had not yet been mastic sealed
35.14 Taps & Controls		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Plumber	N/A	No	Common practice is to have a mastic seal to be made around the perimeter of the shower controls
35.15 Pedestals		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Builder has installed two panels to the rear of the toilet pedestal but both are loosely installed I would recommend mastic sealing into position
35.16 Toilets & Se	eats	Pass			
35.17 Shaving Po	ints	Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Not tested at the time of inspection
35.18 Towel Rail		Pass			
















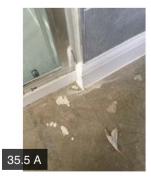





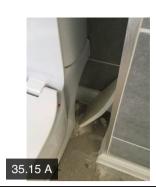

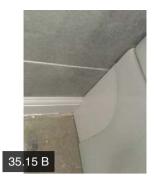


### BEDROOM 2

36.1 Room Name	)	Pass	Bedroom rear left			
36.2 Plastering &	36.2 Plastering & Dry Lining					
36.3 Finishes		Fail				
	Action	Assignee	Due Date	Complete?	Action Comments	
	Action 1	Decorator	N/A	No	For finishing and fitting around the spotlights inside of the bedroom area	
	Action 2	Decorator	N/A	No	Poor finish in the wall area to the left-hand side of the built-in wardrobe	
36.4 Floors		Pass				
36.5 Windows		Pass				
36.6 Skirting / Plin	nths	Pass				
36.7 Doors		Fail				
	Action	Assignee	Due Date	Complete?	Action Comments	
	Action 1	Carpenter	N/A	No	Damage is noted to the bottom of the bedroom door	
36.8 Lights		Pass				
36.9 Sockets		Pass				
36.10 Radiators		Pass				
36.11 Wardrobes		Pass				
	Action	Assignee	Due Date	Complete?	Action Comments	
	Action 1	Carpenter	N/A	No	Please remove the plastic protective film from the built-in wardrobe doors	
36.12 Drawers	36.12 Drawers					







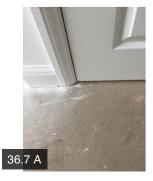





BEDROOM 2 EN	SUITE				
37.1 Plastering &	Dry Lining				
37.2 Finishes					
37.3 Floors					
37.4 Windows					
37.5 Skirting / Pli	nths				
37.6 Doors					
37.7 Lights					
37.8 Sockets					
37.9 Radiators					
37.10 Baths					
37.11 Shower Tra	ays				
37.12 Cubicles /	Wet Rooms				
37.13 Basins					
37.14 Taps & Cor	ntrols				
37.15 Pedestals					
37.16 Toilets & Se	eats				
37.17 Shaving Po	bints				
37.18 Towel Rail					
37.19 Extractor					
BEDROOM 3					
38.1 Room Name	)	Pass	Bedroom rea	ar right	
38.2 Plastering &	Dry Lining	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Poor Decorative finish in the wall area to The left-hand side as you step foot into the bedroom
38.3 Finishes		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments

	Action 1	Decorator	N/A	No	Poor finish to the window board
					inside the bedroom area
	Action 2	Decorator	N/A	No	Poor finish around the double sockets inside the bedroom area also
	Action 3	Builder	N/A	No	Overpainted is noted to the built-in wardrobe and requires cleaning down
38.4 Floors		Pass			
38.5 Windows		Pass			
38.6 Skirting / Pli	nths	Pass			
38.7 Doors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Carpenter	N/A	No	Damage noted to the rear face of the bedroom door
	Action 2	Carpenter	N/A	No	Damage noted along the bottom edge of the front face of the bedroom door
38.8 Lights		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Electrician	N/A	No	Spotlights have been poorly fitted and have dropped from the ceiling
38.9 Sockets		Pass			
38.10 Radiators		Pass			
38.11 Wardrobes		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Please clean down the built-in wardrobe doors and frame
38.12 Drawers		N/A			






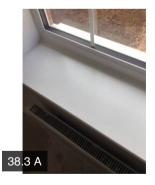

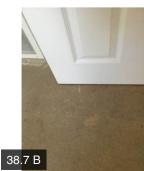



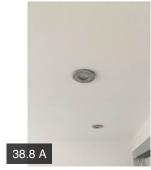









BEDROOM 3 ENSUITE				
39.1 Plastering & Dry Lining				
39.2 Finishes				
39.3 Floors				
39.4 Windows				
39.5 Skirting / Plinths				
39.6 Doors				
39.7 Lights				
39.8 Sockets				
39.9 Radiators				
39.10 Baths				
39.11 Shower Trays				
39.12 Cubicles / Wet Rooms				
39.13 Basins				
39.14 Taps & Controls				
39.15 Pedestals				
39.16 Toilets & Seats				
39.17 Shaving Points				
39.18 Towel Rail				
39.19 Extractor				
BEDROOM 4				
40.1 Room Name	Pass	Bedroom fro	nt right	
40.2 Plastering & Dry Lining	Pass			
40.3 Finishes	Fail			
Action	Assignee	Due Date	Complete?	Action Comments
Action 1	Decorator	N/A	No	Poor finish and fitting around the spotlights inside the bedroom area
Action 2	Electrician	N/A	No	Poor fitting and finish around the double light switch

	Action 3	Decorator	N/A	No	Debris is noted to the window board which would benefit from being refinished
	Action 4	Builder	N/A	No	Over paint is noted to the bottom of the built-in wardrobe and requires cleaning down
	Action 5	Decorator	N/A	No	Further decorative attention is awaiting to been applied to the wall to the rear of the bedroom door And also above the door frame
	Action 6	Decorator	N/A	No	Pencil marks are noted in the wall area to the right-hand side of the double socket
40.4 Floors		Pass			
40.5 Window	S	Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Can the builder once the glazing has been cleaned down inspect all windows for any scratches or damage and any that are scratched or damaged please either replace or polish the scratches out
40.6 Skirting	/ Plinths	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Carpenter	N/A	No	Chip noted to the corner of the skirting board requires making good
	Action 2	Decorator	N/A	No	Further decorative attention to be applied to the skirting board to the left-hand side of the built-in wardrobe door frame
40.7 Doors		Fail		•	
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Carpenter	N/A	No	Damage noted to the rear of the bedroom door
40.8 Lights		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Electrician	N/A	No	Spotlights have dropped from the ceiling and require refitting flush please throughout the whole property
40.9 Sockets		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Over paint noted to the double sockets requires cleaning down
40.10 Radiators		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Plumber	N/A	No	Cover caps Require fitting into position once the decorative works have been completed around the radiator tiles
	bes	Pass			


	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Carpenter	N/A	No	Please remove all plastic protective film from the built in wardrobes
40.12 Drawers		N/A			

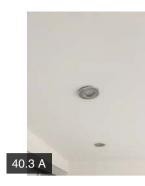





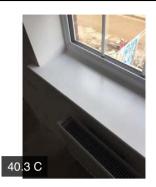




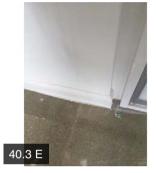


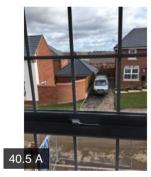

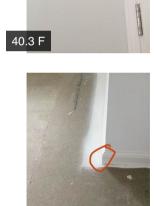



40.6 A

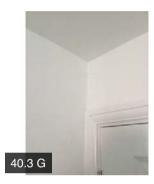


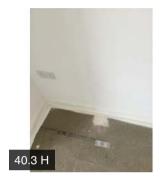



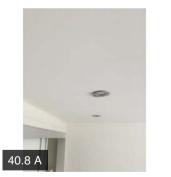

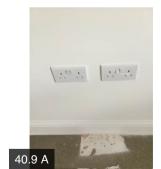

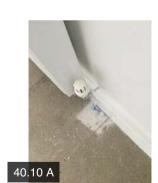

40.6 B



### BATHROOM

41.1 Plastering & Dry Lining		Pass			
41.2 Finishes		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Decorator	N/A	No	Further decorative attention is required around the isolator switch
	Action 2	Tiler	N/A	No	Temporary tiles have been installed in the family bathroom builder is aware


	Action 3	Tiler	N/A	No	Chip noted to the wall tiling to the right-hand side of the tap to the handbasin
41.3 Floors		Pass			
41.4 Windows	S	Pass			
41.5 Skirting	/ Plinths	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Tiler	N/A	No	Temporary tile installed to the left- hand side of the family bathroom door again builder is aware
41.6 Doors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Gap noted between the skirting board and the bath panel and touching up is also required to the skirting board section
41.7 Lights		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Electrician	N/A	No	Please refit all spotlights flush to the ceiling throughout the property
41.8 Sockets		N/A			
41.9 Radiator	rs	Pass			
41.10 Baths		Pass			
41.11 Shower	r Trays	N/A			
41.12 Cubicle	es / Wet Rooms	N/A			
41.13 Basins		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Builder	N/A	No	Builder has partially sealed between the handbasin and the basin pedestal that has not done this in other wet rooms
41.14 Taps &	Controls	Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Plumber	N/A	No	Shower controls at the time of inspection have not yet been mastic seal around as is common practice
41.15 Pedest	als	Fail		•	
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Plumber	N/A	No	Panels missing to the right hand side of the rear of the toilet pedestal
41.16 Toilets	& Seats	Pass			
41.17 Shaving	g Points	N/A			
41.18 Towel F	Rail	N/A			
41.19 Extract	or	Pass			











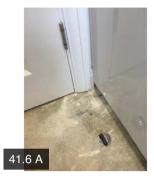

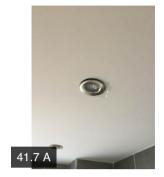



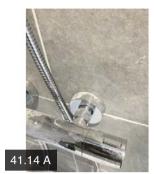




BATHROOM 2	
42.1 Plastering & Dry Lining	
42.2 Finishes	
42.3 Floors	
42.4 Windows	
42.5 Skirting / Plinths	
42.6 Doors	
42.7 Lights	
42.8 Sockets	
42.9 Radiators	
42.10 Baths	
42.11 Shower Trays	
42.12 Cubicles / Wet Rooms	
42.13 Basins	
42.14 Taps & Controls	
42.15 Pedestals	

42.16 Toilets & Seats					
42.17 Shaving P	oints				
42.18 Towel Rail					
42.19 Extractor					
AIRING CUPBO	ARD				
43.1 Plastering 8	Dry Lining	Pass			
43.2 Finishes		Pass			
43.3 Floors		Pass			
43.4 Skirting / Pli	inths	Pass			
43.5 Doors		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Carpenter	N/A	No	Damage noted to the rear of the cylinder cupboard door
	Action 2	Carpenter	N/A	No	The cylinder cupboard door does not latch at the time of inspection and requires some minor adjustment
43.6 Lights		N/A			
43.7 Sockets	43.7 Sockets				
43.8 Hot Water T	ānk	Pass			



STORAGE CUPB	SOARD				
44.1 Plastering &	Dry Lining				
44.2 Finishes					
44.3 Floors					
44.4 Skirting / Pli	nths				
44.5 Doors					
44.6 Lights					
44.7 Sockets					
LOFT					
45.1 Hatch		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments

	Action 1	Builder	N/A	No	At the time of inspection I could not close or lock the loft hatch builder please investigate
45.2 Ladder		N/A			
45.3 Felt		Pass			
45.4 Ducting		Fail			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Plumber	N/A	No	It appears as though the durgo has yet to be fitted at the time of inspection
45.5 Insulation		Pass			
45.6 Cable & Wires		Pass			
45.7 Timbers		Pass			
	Action	Assignee	Due Date	Complete?	Action Comments
	Action 1	Carpenter	N/A	No	Split noted around the loft hatch , builder please make good
45.8 Cold Water Tanks		N/A			

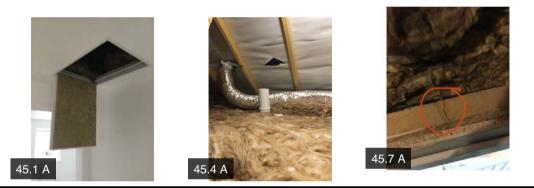

#### SERVICES

46.1 Heating	Pass	
46.2 Underfloor Heating	N/A	
46.3 Boiler	Pass	
46.4 Smoke / Heat / CO2 Detectors	Pass	

#### FINAL COMMENTS

Homeowner comments that they believe the rear fence to the property has been installed in the incorrect location and not following the line shown in the TP1 drawing, builder to check and confirm please

Homeowner comments that according to the specification the spotlights in the property should be white and not chrome